



AIR CONDITIONER COMPRESSOR OIL

Reports from the field say MaxxPro MRAP air conditioning compressors are going belly up.

That's because the wrong refrigerant oil is listed as Item 37 in the Expendable and Durable Item List (EDIL) in TM 9-2355-106-23-1, Item 32 of the EDIL in TM 9-2355-318-23-3, and Item 30 of the EDIL in TM 9-2355-324-23-1. That oil causes the compressor to wear out. No compressor—no air conditioning!

So use NSN 9150-01-546-5096 to get the right PAG 46 refrigerant oil. Also, do not mix refrigerant oils—that'll only damage the air compressor.